



G01/G02/G30/G32 NVLD LIMITED WARRANTY EXTENSION TO 15 YEARS/150,000 MILES

This Service Information bulletin (Revision 01) supersedes SI B01 09 21 **dated August 2021**

What's New:

- 2018 X3 xDrive30i, 2019 X4 M40i, 2018 to 2020 530i and xDrive, 2018 to 2019 X3 M40i, 640i, 2018 to 2020 540i and xDrive and the 2019 to 2020 M550i xDrive have been added
- MY 2017 BMW 530i Sedan and xDrive (B460) PZEV/SULEV statement added
- Defect Code updated and the Diagnosis work time labor operation and related contended was added
- The non-qualifying repair statement has been updated.

MODEL

E-Series	MY	Model Description	Production Dates	Engine
G01	2019	X3 sDrive	April 2, 2018 to July 29, 2019	B46
G01	2018 to 2019	X3 xDrive	July 14, 2017 to July 29, 2019	B46
G01	2018 to 2019	X3 M40i	July 12, 2017 to July 28, 2019	B58M
G02	2019	X4 xDrive	May 10, 2018 to July 27, 2019	B46
G02	2019	X4 M40i	October 28, 2017 to July 15, 2019	B58M
G30	2017 to 2020	530i Sedan	October 11, 2016 to June 30, 2020	B46O/D
G30	2017 to 2020	530i xDrive Sedan	October 11, 2016 to June 26, 2020	B46O/D
G30	2018 to 2020	540i Sedan	June 28, 2017 to June 18, 2020	B58M
G30	2018 to 2020	540i xDrive Sedan	June 26, 2017 to June 26, 2020	B58M
G30	2019 to 2020	M550i xDrive Sedan	June 12, 2018 to June 24, 2020	N63R
G32	2018 to 2019	640i xDrive Gran Turismo	June 29, 2017 to June 27, 2019	B58M

Note: The Model information above is for informational purposes only, it is not the only deciding factor.

Note: 2018 X3 xDrive30i, 2019 X4 M40i, 2017 to 2020 530i and xDrive, 2018 to 2019 X3 M40i, 640i, 2018 to 2020 540i and xDrive and the 2019 to 2020 M550i xDrive have been added to this bulletin update as of July 2022

Eligible Vehicles

To assist you in identifying those vehicles that have this component-specific extended limited warranty coverage, the DCSnet Warranty Vehicle Inquiry has been updated with the VIN and Component-specific Vehicle Comment shown below:

Please see SI B01 09 21 (DC 16 13 91 12 00): For this vehicle, the NVLD limited emission-related warranty for defects in materials or workmanship has been extended to 15 years/150,000 miles as determined from the original in-service date. This coverage is subject to the same vehicle eligibility requirements, limitations, and exclusions that apply to the BMW New Vehicle Limited Warranty.

Note: Before performing a repair and submitting a claim, first confirm that the vehicle has the above Notice of Limited Warranty Extension in the DCSnet Warranty Inquiry Vehicle Comments section.

If you have Extended Limited Warranty (ELW) eligibility and/or coverage questions, please contact the Warranty department through IDS by selecting Coverage, Policy, Coding Questions and Mileage Corrections prior to performing any repair.

SITUATION

Component-Specific Limited Warranty Extension

For the eligible vehicles, BMW of North America, LLC (BMW NA) is extending the limited warranty for the vehicle's **Leak Diagnosis Module with hose assembly (NVLD, shown)** to:

- 15 years/150,000 miles as determined by the vehicle's original in-service date.



For eligible MY 2017 BMW 530i Sedan and xDrive (B460) vehicles that are currently registered in the State of California (CA) or a State that has fully adopted the State of California PZEV/SULEV regulation (CT, ME, MD, MA, NJ, NY, RI, and VT), the standard “component-related” coverage for the NVLD is 15 years/150,000 miles.

This component-specific limited warranty extension applies to defects in materials or workmanship.

This coverage is subject to the same vehicle eligibility requirements, limitations, and exclusions that apply to the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Note: This bulletin is notice of a limited warranty extension. This is NOT a notice of a Recall or Service Action.

There is no immediate repair required unless the BMW vehicle is currently experiencing this problem.

Customer Notification Letter

Even though this is NOT a Recall, BMW NA is sending VIN-specific customer notification letters.

CAUSE

Over time, the Leak Diagnosis Module (NVLD) (with connected hose) component material may fail, this can create a fine leak to develop in the Evaporative Emission Control System (EVAP). Should this occur, corresponding fault codes will be stored in the DME memory and the MIL (Malfunction Indicator Lamp) will illuminate.

CORRECTION

Follow the instructions in the PROCEDURE section.

PROCEDURE

If an applicable Model vehicle arrives at your center with the issue described above, perform the corresponding diagnosis, and replace the NVLD assembly as determined and/or as instructed.

Additionally, any other repair that requires the replacement of the NVLD due to a defect in material and workmanship is also covered under the extended time and mileage limits described in this bulletin.

PARTS INFORMATION

Please refer to the Electronic Parts Catalog (ETK/EPC), using the customer’s VIN to locate the applicable replacement part numbers.

Part Number	Description	Quantity
Refer to ETK	Venting line with leak diagnosis module	1

- Only order these **parts in the quantities needed** to address customers’ vehicles that have confirmed failures.
- **Only in conjunction with parts:** When applicable, if ETK/EPC item identifies additional part(s) that must also be replaced/installed in-conjunction with performing a covered repair, these required additional items are also covered under the terms of this extended limited warranty.
- Also refer to ETK/EPC and the repair instructions for onetime-use fasteners/screws and other information regarding repair-related gaskets, seals, fluid and/or lubricants that also need to be replaced/used and claimed.

CLAIM INFORMATION

This component-specific limited warranty extension to 15 years/150,000 miles applies to eligible US-specification BMW vehicles that are registered, operated, and have their covered repair performed by an authorized BMW center in the United States (including Puerto Rico) for defects in materials or workmanship.

For eligible MY 2017 BMW 530i Sedan and xDrive (B460) vehicles that are currently registered in the State of California (CA) or a State that has fully adopted the State of California PZEV/SULEV regulation (CT, ME, MD, MA, NJ, NY, RI, and VT), the standard “component-related” coverage for the NVLD is 15 years/150,000 miles.

This component-specific extended limited warranty coverage is subject to the same corresponding vehicle eligibility requirements, limitations, and exclusion criteria that applies to all repairs that will result with a claim submission to BMW.

The existing limited warranty coverage for the whole vehicle and other components has not changed.

This coverage supersedes the coverage that is provided under the BMW Certified Pre-Owned Program or any BMW Group Vehicle Service Contract that applies to the vehicle.

Should the front oxygen sensor fail again, it is covered by the remaining portion of the extended limited warranty coverage period.

Non-Qualifying Repairs

Repairs performed on ineligible vehicles, eligible vehicles operated and repaired outside the United States and Puerto Rico, and/or the diagnosis and repair of issues beyond the scope of this component-specific coverage, or that are due to outside influences, or any other unrelated issues are not covered by this limited warranty extension. This exclusion also applies to repairs that were performed using (including those repairs that result from using) non-genuine BMW parts and/or used BMW passenger car or light truck parts.

Qualifying Repairs – Claim Submission, as determined by the Original In-Service Date

Defect Code:	1613911200	G0x G3x US version leak diagnosis system NVLD
---------------------	-------------------	--

Refer to AIR for the corresponding flat rate unit (FRU) allowances.

Labor Operation	Description	Labor Allowance
00 00 006	Performing vehicle test (with vehicle diagnosis system – checking faults) (Main work)	Refer to AIR
Or:		
00 00 556	Performing vehicle test (with vehicle diagnosis system – checking faults) (Plus work)	Refer to AIR
And:		
61 21 528	Support voltage of the vehicle electrical system / recharge vehicle electrical system battery	Refer to AIR
And, as necessary:		
61 00 006*	Performing vehicle diagnosis – test module (Work time)	(WT)
Or		
00 58 500*	Diagnosis Worktime Flat Rate (See below)	2 FRU
And, as necessary:		
16 00 510	Leak detection on fuel tank and tank ventilation system (Work time)	5 FRU
And:		
16 13 523	Removing and installing/replacing diagnostic module for tank leaks for Natural Vacuum Leak Detection (NVLD)	Refer to AIR

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead of 00 00 006, or exclude (including 61 21 528) when the Vehicle Test is included in another repair.

Work time labor operation code 61 00 006, 00 58 500 and 16 00 510 are not considered Main labor operations.

*Based on which one applies to your center, please refer to [SI B01 01 20](#) or [B01 07 20](#) for the applicable procedure for documenting, claiming, and explaining, on the RO and in the claim comments, your diagnosis work time (WT), job/repair work time (WT), and the vehicle repairs your center performed, unless otherwise required by State law.

Previous Customer-Pay Repairs – Limited Warranty Extension Reimbursement

BMW of North America, LLC (BMW NA) will provide reimbursement for qualifying customer-pay repairs that were performed on an eligible vehicle **prior** to the release of this component-specific limited warranty extension.

Note: 2018 X3 xDrive30i, 2019 X4 M40i, 2017 to 2020 530i and xDrive, 2018 to 2019 X3 M40i, 640i, 2018 to 2020 540i and xDrive and the 2019 to 2020 M550i xDrive have been added to this bulletin update as of July 2022

Customer-pay repairs are subject to the same vehicle eligibility requirements, limitations, and exclusions that apply to the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Repairs that Do Not Qualify for Reimbursement

Repairs performed on ineligible vehicles, eligible vehicles operated and repaired outside the United States and Puerto Rico, and/or the diagnosis and repair of issues beyond the scope of this component-specific coverage, or that are due to outside influences, or any other unrelated issues are not covered by this limited warranty extension. This exclusion also applies to repairs that were performed using (including those repairs that result from using) non-genuine BMW parts and/or used BMW passenger car or light truck parts.

Requesting Reimbursement for a Previous Repair That Qualifies

For a customer to request reimbursement for a qualifying customer-pay repair performed either by an authorized BMW center or independent repair shop located in the United States (including Puerto Rico), please have him/her submit his/her reimbursement request online at www.BMW-RP.com under the following reference:

- B-ELWR NVLD 15Y150M

Reimbursement Request Procedure

The online process is initiated by attaching/sending PDF files of the supporting documentation for the prior repair.

The letter also includes alternative methods to request reimbursement, either through the mail or by fax as described below:

BMW Customer Reimbursement Center
Attention: B-ELWR NVLD 15Y150M
P.O. Box 54067
Hurst, Texas 76054

Fax number: 877-434-2992

Please allow 4-6 weeks for processing your request.

Should you have any questions concerning this reimbursement process, please call 1-844-857-0341.

FEEDBACK REGARDING THIS BULLETIN

Technical Feedback	To submit feedback for the technical topics of this bulletin: Submit your feedback in the rating box at the top of this bulletin
Warranty Feedback	To submit feedback for the CLAIMS section of this bulletin: Submit an IDS ticket to the Warranty Department, or use the chat available in the Warranty Documentation Portal
Parts Feedback	To submit feedback for the PARTS section of this bulletin: Submit an IDS ticket to the Parts Department

Supporting Materials

[picture as pdf B01 09 21 Cust Sample Letter \(8_2022\).pdf](#)

