



MODEL

F90 (M5)

SITUATION

There is a humming or droning noise coming from the rear seat or fuel tank area while the engine is idling.

CAUSE

DME calibration for the activation strategy of the fuel pump.

CORRECTION

Program the vehicle with updated DME software.

PROCEDURE

Program the vehicle using ISTA Next 4.10.4x.

Target integration level: 18-03-530 or higher.

Note that ISTA Next will automatically reprogram and code all programmable control modules that do not have the latest software.

For information on programming and coding with ISTA/P, refer to CenterNet / Aftersales Portal / Service / Workshop Technology / Vehicle Programming.

Always connect a BMW approved battery charger/power supply (SI B04 23 10).

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks or the BMW Certified Pre-Owned Program.

Defect Code:	1614043900	
Labor Operation:	Labor Allowance:	Description:
00 00 006	Refer to KSD2	Performing "vehicle test" (with vehicle diagnosis system – checking faults) (Main work)
Or:		
00 00 556	Refer to KSD2	Performing "vehicle test" (with vehicle diagnosis system – checking faults) (Plus work)

And:		
61 21 528	Refer to KSD2	Connect an approved battery charger/power supply (indicated in KSD2 as "Charging battery")
And:		
61 00 730	Refer to KSD2	Programming/encoding control unit(s)

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead of 00 00 006.

Refer to KSD2/AIR for the corresponding flat rate unit (FRU) allowances.

During the same workshop visit, if a vehicle also requires another Technical Campaign or repair that also includes programming and encoding the control units, the programming procedure may only be invoiced one time.

Vehicle Programming and Encoding

A. The programming procedure automatically reprograms and encodes all vehicle control modules which do not have the latest software i-level. If one or more control module failures occur "during" this programming procedure:

- Please claim this "consequential" control module-related repair work under the defect code listed in this bulletin with the applicable KSD2/AIR labor operations.

Please explain this additional work (The why and what) on the repair order in the claim comments section.

B. For control module failures that occurred "prior" to performing this programming procedure:

- When "covered" under an applicable limited warranty, claim this control module-related repair work using the applicable defect code and labor operations (including diagnosis) in KSD2/AIR.