



MODEL

112 (i8)

SITUATION

After vehicle runs out of fuel (fuel tank completely empty), refilling by a small volume of gasoline (less than 1.5 gallon) is not sufficient to start the combustion engine.

The DME does not recognize small increments of refueling.

CAUSE

DME software error

PROCEDURE

Program/recode the vehicle using the latest version of ISTA/P (3.57.0 or higher).

Target integration level: 15-11-501 or higher

Note that ISTA/P will automatically reprogram and code all programmable control modules that do not have the latest software.

Always connect a BMW approved battery charger/power supply (SI B04 23 10).

For information on programming and coding with ISTA/P, refer to CenterNet / Aftersales Portal / Service / Workshop Technology / Vehicle Programming.

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks or the BMW Certified Pre-Owned Program.

Defect Code:	16 14 13 02 00	
Labor Operation:	Labor Allowance:	Description:
00 00 006	Refer to KSD2	Performing "vehicle test" (with vehicle diagnosis system – checking faults)
And:		
61 25 910	Refer to KSD2	Recharging high-voltage battery unit (to high voltage charging unit)
And:		
61 00 730	Refer to KSD2	Programming / encoding control unit(s)
And:		
61 21 528	Refer to KSD2	Connect an approved battery charger/power supply(indicated in KSD2 as "Charging battery")

Labor operation code 00 00 006 is a Main labor operation. If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowances.

Vehicle Programming and Encoding

If a control module was working properly and it fails to program correctly or requires initialization, please claim this additional work with the applicable KSD2 labor operations under the defect code listed above.

The diagnosis and repair of vehicles “arriving” with failed control modules or stored faults which will cause them to fail during programming cannot be claimed under the defect code listed in this bulletin.

Other Repairs

If other eligible and covered work is performed “prior” to programming and coding the vehicle, claim this work with the applicable defect code and labor operations listed in KSD2.