



SITUATION

The following wheel speed sensors faults may be stored in the DSC control module:

- 0x480710 – Wheel speed sensor front left, plausibility direction of rotation
- 0x480713 – Wheel speed sensor front right, plausibility direction of rotation
- 0x480716 – Wheel speed sensor rear left, plausibility direction of rotation
- 0x480719 – Wheel speed sensor rear right, plausibility direction of rotation

CAUSE

Erroneous speed sensor plausibility faults

INFORMATION

These faults do NOT indicate brake system malfunction, or cause Check Control message display.

Do not replace any parts!

Perform a 12V battery reset and clear the fault memory.

In case one of the plausibility faults returns after a short test drive, diagnose it using the corresponding ISTA test plan for the wheel speed sensor faults.

WARRANTY

Not Applicable