



SQUEAKING NOISE FROM CENTER CONSOLE

MODEL

E-Series	Model Description
F95	X5 M Sports Activity Vehicle
F96	X6 M Sports Activity Coupe
G05	X5 Sports Activity Vehicle
G06	X6 Sports Activity Coupe
G07	X7 Sports Activity Vehicle

SITUATION

A squeaking noise is present when pressing the release button to open the center console.

CAUSE


Interference in the center console release mechanism.

CORRECTION

Lubricate the release mechanism.

PROCEDURE

1. Remove the center console trim following repair instructions **REP 51 16 160 “Removing and installing the center console trim”**.

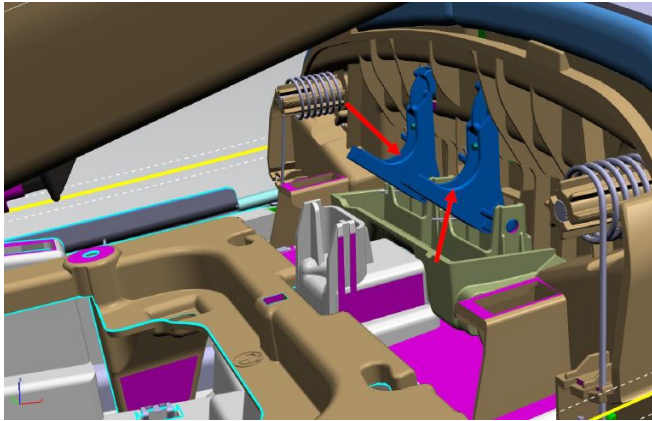

2. Apply Krytox lubricant P/N 83 19 5 A4E 439 to the rounded side of the release mechanism as shown (arrows).

3. Re-assemble the vehicle and retest.

PARTS INFORMATION

Part Number	Description	Quantity	Notes
83 19 9 408 523	Special Sliding Agent	Sublet as needed	Use this part number first, when stock is depleted it will be superseded by 83 19 5A4 E439
83 19 5A4 E439	Special lubricant (Krytox)	Sublet as needed	

CLAIM INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Defect Code:	5116313900	Hinged tray, front center armrest Unpleasant noises
---------------------	-------------------	--

Refer to AIR for the corresponding flat rate unit (FRU) allowances.

Labor Operation	Description	Labor Allowance
51 16 160	Removing and installing the center console trim (Main work)	Refer to AIR
Or:		
51 16 660	Removing and installing the center console trim (Plus	Refer to AIR

	work)	
And:		
51 99 000	Work time to apply lubricant to the rounded side of the release mechanism	1 FRU

Work time labor operation code 51 99 000 is not considered a Main labor operation.

And, as needed:

Sublet – Bulk Materials (RO and Claim Comments Required)

Sublet Code 4	See the sublet reimbursement calculations below	Reimbursement for the repair-related bulk material (Do not use the BMW part number for claim submission)
-------------------------	---	--

Sublet reimbursement calculation for claiming the applicable repair-related bulk material (BMW part number) is at the dealer net price amount for the quantity used plus your center’s handling.

Enter this material cost in sublet and itemize the amount on the repair order and in claim comment section

Based on which one applies to your center, please refer to **SI B01 01 20** or **B01 07 20** for claiming your diagnosis work time, job/repair work time (WT), RO/Claim WT and/or repair explanation procedures, unless otherwise required by State law.

QUESTIONS REGARDING THIS BULLETIN

Technical inquiries	Submit feedback at the top of this bulletin
Warranty inquiries	Please contact the Warranty department by either using the Live Chat that’s available in the Warranty Documentation Portal or through IDS by selecting Coverage, Policy, Coding Questions and Mileage Corrections
Parts inquiries	Submit an IDS ticket to the Parts Department