



## MODEL

112 (i8) Vehicles produced until August 2015.

## SITUATION

Snow or dust may accumulate in entrance area



Accumulation can occur in the area shown.

## CAUSE

Excessive clearance in door sill area.

## CORRECTION

Replace entrance cover and entrance molding on both sides.

## PROCEDURE



1. Replace the door entrance cover on both sides as shown in RA "51 47 065 **Removing and installing/replacing cover at front left or right entrance.**



2. Replace the door entrance molding on both sides.

## PARTS INFORMATION

Part Number	Description	Quantity
51 77 7 428 971	Door entrance panel, left	1
51 77 7 410 033	Door entrance molding, left	1
51 77 7 428 972	Door entrance panel, right	1
51 77 7 410 034	Door entrance molding, right	1

## WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

<b>Defect Code:</b>	<b>51 47 19 41 00</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
51 47 070	Refer to KSD2	Removing and/or installing or replacing cover plates on both front door entrances (Main work)
Or:		
51 47 570	Refer to KSD2	Removing and/or installing or replacing cover plates on both front door entrances (Plus work)

If you are using a Main labor code for another repair, use the Plus code labor operation 51 47 570 instead.