



MODEL

G30 (5 Series Sedan)			
----------------------	--	--	--

SITUATION

When unlocking trunk, the trunk lid does not release (mechanism activation is heard). The trunk does not open fully, or at all.

Situation may occur at ambient temperatures below freezing, or may also occur at moderate temperatures.

CAUSE

Trunk lid gasket remains adhered to its seating surfaces.

CORRECTION

Apply a **non-petroleum** based lubricant to trunk lid gasket.

PROCEDURE

For conditions that are similar to the situation described:

1. If ambient temperatures are below freezing, allow body of vehicle to warm up.
2. Carefully open trunk lid being sure not to damage the gasket. Obtain assistance, if necessary, to release the gasket from both sides simultaneously.
3. Lubricate entire trunk lid gasket with Carbaflo.



Note: Do not use any petroleum based lubricant.



Note: Replace gasket **only** if damaged.

PARTS INFORMATION

Part Number	Description	Quantity
83 23 0 309 627	Lubricant, Carbaflo KSP105 (50g)	As needed

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Defect Code:	5171034100	
Labor Operation:	Labor Allowance:	Description:
51 99 000	3 FRU	Work time to lubricate Trunk Seal (Main work)
Or:		
51 99 000	1 FRU	Work time to lubricate Trunk Seal (Plus work – Vehicle is already in the workshop)

Or, with:

Replacing gasket (Only if damaged)

Labor Operation:	Labor Allowance:	Description:
51 76 046	Refer to KSD2	Replace tailgate gasket (Main work)
Or:		
51 76 546	Refer to KSD2	Replace tailgate gasket (Plus work)
And:		
51 99 000	1 FRU	Work time to lubricate Trunk Seal (Associated work)

And:

Sublet – Bulk Materials

Sublet Code 4	See sublet reimbursement calculation below	Reimbursement for the repair-related bulk material (BMW part number, please do not use the part numbers for claim submission)
----------------------	--	---

Sublet reimbursement calculation for claiming the “used quantities” of repair-related bulk material (BMW part numbers) is at dealer net plus your center’s handling.

Enter this material cost in sublet and itemize the amount on the repair order and in claim comment section.