



MODEL

I12 (I8)

SITUATION

A rattling noise is heard coming from the lower front door area while driving or closing the door.

CAUSE

The lower power window regulator mounting screws have loosened over time.

PROCEDURE

If the customer reports this issue, check and tighten both lower screws (where shown) on each front door to 8 Nm.



WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Defect Code:	51 33 12 39 00	
Labor Operation:	Labor Allowance:	Description:
51 99 000	4 FRU	Work time to tighten Loose screws for both doors (Main work)
Or:		
51 99 000	2 FRU	Work time to tighten Loose screws for both doors (Plus work – Vehicle is already in the workshop)