



**MODEL**

E-Series	Model Description	Production Date
G29	Z4 Roadster	March 4, 2021 – March 5, 2021

**AFFECTED VEHICLES**

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

For centers that qualify, this repair is eligible to be performed via Mobile Assistance.

**SITUATION**

The seat wiring harness on the left front area of the driver's seat of the affected vehicles may have been routed incorrectly. If the seat wiring harness is routed incorrectly, it may be damaged during seat height adjustment. This could cause the adjustment functions to fail partially or completely.

**CAUSE**

Incorrect harness routing.

**CORRECTION**

Check and if necessary, correct the cable routing in the affected vehicles.


**PROCEDURE**



1. Check the wiring harness installation arrangement on the installed left front seat.

**If the routing of the seat wiring harness is OK, this Technical Campaign is now complete. Replace no parts.**

2. If the routing is incorrect (NOK stands for not OK), continue to **step 3**.

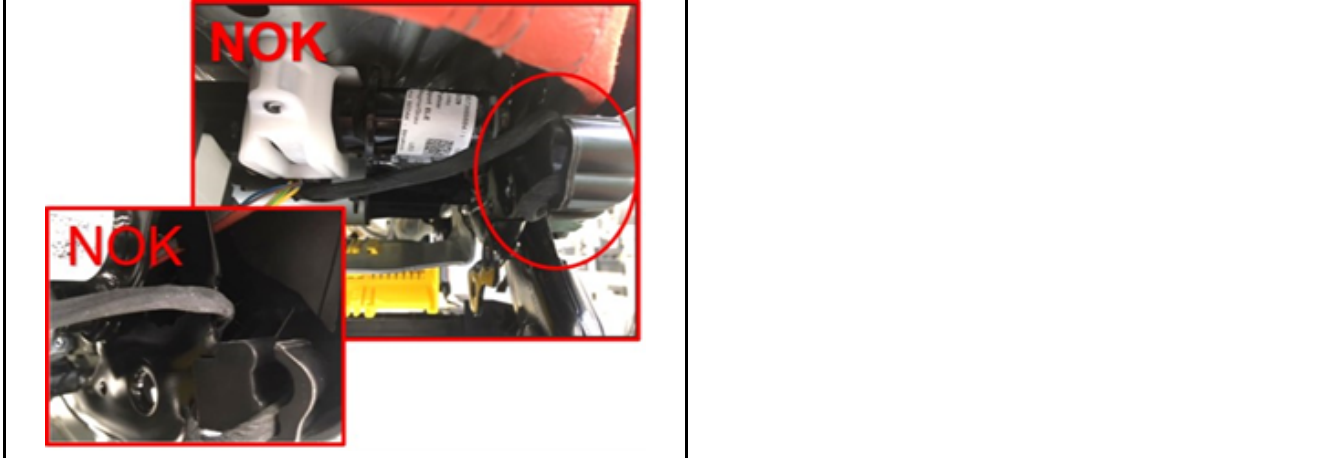

3. If the routing of the seat wiring harness is faulty, remove the left seat according to Repair Instructions 52 13 001 Removing the driver's seat.

Check whether the wiring harness is severely damaged, if so, continue according to **step 4**.

**If the wiring harness is not damaged**, then route the wiring harness correctly in accordance with the attached repair instructions (Harness Routing). **The Technical Campaign ends here; replace no parts.**

4. **If the seat wiring harness is severely damaged**, it must be replaced in accordance with the attached repair instructions (Damaged harness).

**NOTE:** When removing the seat the 4 screws must be replaced.

## **PARTS INFORMATION**

Part Number	Description	Quantity
61 12 8 716 470	Seat cable set on the left	1
72 11 9 813 974	Hexagon bolt	1
07 14 9 321 690	Cap screw (seat rails to floor)	4

### **Note:**

Other small parts such as clips, cable straps, screws, nuts and seals, which must be replaced on the basis of the ISTA repair instructions, are to be selected from the Electronic Parts Catalogue according to the respective vehicle type and invoiced under the special defect code.

## **WARRANTY INFORMATION**

Reimbursement for this Service Action will be via normal claim entry utilizing the applicable work package information below, and when required, the part numbers listed above.

<b>Defect Code:</b>	<b>0061980500</b>	<b>G29 Checking and if necessary reworking front seat wiring harness routing</b>
---------------------	-------------------	--

**Completion before the first vehicle delivery to a customer or the vehicle is already in the workshop**

Work Pkg	Labor Operation	Description (Plus work)	Labor Allowance
# 1	00 70 875	Checking the routing of the front seat wiring harness <b>(No repair necessary)</b>	3 FRU
Or:			
# 2	00 70 876	Checking the routing of the front seat wiring harness and <b>reworking it into the correct position</b>	8 FRU
Or:			
# 3	00 70 877	Checking the routing of front seat wiring harness and <b>replacing it (due to damage) into the correct position</b>	24 FRU

Or:

**The vehicle arrives at your center and this Service Action shows open (No other main work will be performed or claimed during this workshop visit)**

Work Pkg	Labor Operation	Description (Main work)	Labor Allowance
# 4	00 70 329	Checking the routing of the front seat wiring harness <b>(No repair necessary)</b>	5 FRU
Or:			
# 5	00 70 330	Checking the routing of the front seat wiring harness and <b>reworking it into the correct position</b>	10 FRU
Or:			
# 6	00 70 331	Checking the routing of front seat wiring harness and <b>replacing it (due to damage) into the correct position</b>	25 FRU

Only one of the flat rate labor operation codes listed above can be used for claim submission and reimbursement. Also, only one Main work flat rate labor operation code can be claimed per workshop visit.

### Claim Repair Comments

Only reference the SIB number and the work package (Pkg) number performed in the RO technician notes and the claim comments (For example: B52 07 21 WP 1), unless otherwise required by State law.

### Alternative Mobility Solution (AMS) for Vehicle Owners (RO and Claim Comments Required)

This Service Action repair qualifies for Alternative Mobility Solution (AMS) expense reimbursement, claim this item under the Defect Code noted above as follows:

Sublet Code 2 - Itemize the AMS sublet amount on the repair order and in the claim comment section.

Please refer to [SI B01 29 16](#) for additional information.

### QUESTIONS REGARDING THIS BULLETIN

Technical inquiries	Submit feedback at the top of this bulletin
Warranty inquiries	Please contact the Warranty department by either using the Live Chat that's available in the Warranty Documentation Portal or through IDS by selecting Coverage, Policy, Coding Questions and Mileage Corrections
Parts inquiries	Submit an IDS ticket to the Parts Department

### Supporting Materials

[picture as pdf B520721 Attachment G29 Rework damaged harness.pdf](#)

[picture as pdf B520721 Attachment G29 Harness routing.pdf](#)