



Model

G29 (Z4 Roadster)			
Produced until 3/6/2019			

Situation

The upper windshield cowl panel seal may appear deformed as shown below:



Cause

The seal was not fully seated during installation, allowing the convertible top to press the seal out away from the windshield when closed.

Correction

Ensure the seal is completely seated.

Procedure

1. Open the convertible top to allow access to the top of the windshield sealing area.
1. Press down firmly on the seal to ensure it presses completely into the windshield cowl panel. Verify the appearance is uniform across the entire length of the windshield.
1. Completely close the convertible top. It is suggested to leave the convertible top closed for 24 hours to ensure the seal correctly seats into the windshield cowl.

Parts Information

No parts are required.

Warranty Information

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Defect Code:	5431054100	Edge guard/cowl panel seal, roof frame (Convertible, Roadster) poorly adapted/fitted
Labor Operation:	Labor Allowance:	Description:
54 00 001	4 FRU	Work time to reposition the cowl panel seal (Main work)
Or:		
54 00 001	2 FRU	Work time to reposition the cowl panel seal (Plus work – Vehicle is already in the workshop)