



## MODEL


G30 (5 series Sedan)			
Produced through November 15, 2016			

## SITUATION

Front windshield washers spray poorly or not at all.

## CAUSE

Partially or completely pinched supply tube caused by misplaced tube holder on hood hinge.

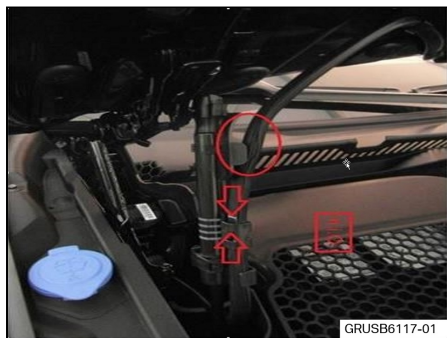

## CORRECTION


Reposition and secure tube holder on the gas pressure spring.

## PROCEDURE

For conditions that are similar to the situation described:



1. Using double-sided tape on the holder where shown, secure the tube holder onto the gas-pressure spring to prevent twisting.

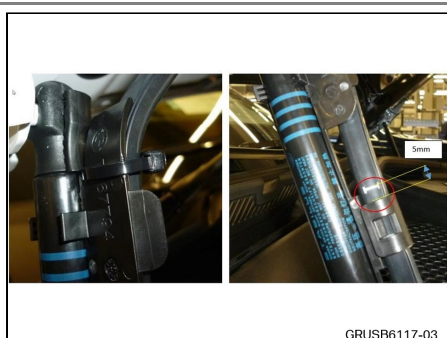

2. Using a cable tie (part number 31 13 1 357 599), attach the tube to the holder observing the dimensions shown.

# PARTS INFORMATION

Part Number	Description	Quantity
61 13 1 367 599	Cable tie	1
83 19 0 445 309*	Double-sided adhesive tape (L=66m, W=19mm)	As needed

\*Or a locally-sourced equivalent

# WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

<b>Defect Code:</b>	<b>6166024800</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
61 99 000	3 FRU	Work time to install double-sided tape and a cable tie on the tube holder (Main work)
Or		
61 99 000	2 FRU	Work time to install double-sided tape and a cable tie on the tube holder (Plus work – Vehicle is already in the workshop)

And, as needed:

## Sublet – Bulk Materials

<b>Sublet Code 4</b>	See sublet reimbursement calculation below	Reimbursement for the used quantity of repair-related bulk material, please do not use part number 83 19 0 445 309 for claim submission
----------------------	--	---

Sublet reimbursement calculation for claiming the used quantity of repair-related bulk material:

- The BMW part number is at dealer net plus your center's handling, or
- Locally-sourced double-sided adhesive tape is "at cost with no handling."