



Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

This Service Information bulletin supersedes SI B63 02 18 **dated June 2018**.

What's new:

- The "Recall statement" has been added for final repair
- "Situation" has been updated.
- "Affected Vehicles" added
- "Correction" added
- "Procedure" added
- "Parts Information" added
- "Warranty Information" added

MODEL

G01 (X3)

SITUATION

BMW Group is conducting a Voluntary Non-Compliance Recall (effective June 21, 2018) on certain Model Year 2018 BMW X3 SAV vehicles produced from December 21, 2017 through March 30, 2018.

This recall involves one or both of the rear turn signals. Each turn signal consists of a section on the rear side panel and a section on the tailgate. The section on the tailgate may flash yellow instead of red.

AFFECTED VEHICLES


Vehicles which require this Recall Campaign to be completed will show it as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

This Recall Campaign involves approximately 5 vehicles are affected by this recall and all have been retailed.

The Q&A has been attached for further information.

CORRECTION

- Turn the Hazard Light switch on
- Check that both turn signal lights mounted on the tailgate flash a red color as shown in the picture.
- If the light is flashing yellow then replace the affected light assembly.
- If the light is flashing red no further repair is needed.

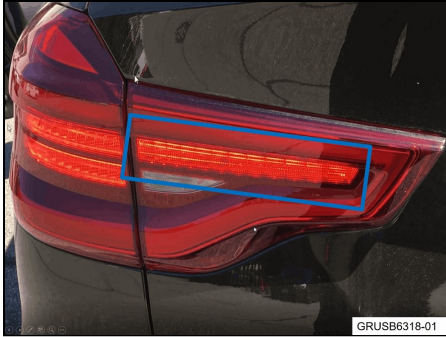

PROCEDURE

For the above situation and If the rear light cluster on the tailgate needs to be replaced follow ISTA repair instructions:

REP 63 21 280 Replacing the rear light on the left side of the tailgate

Or:

REP 63 21 282 Replacing the rear light on the right side of the tailgate.

Or:

REP 63 21 785 Removing and installing both trunk lid tail lights



Note:

If the replacement is necessary you need to submit info only case with attached a picture for the barcode of the part number. The case subject Recall SI B63 02 18.

PARTS INFORMATION

Part Number	Description	Quantity
63 21 7 408 745	Left tailgate rear light	1
63 21 7 408 746	Right tailgate rear light	1



Note:

Other small parts such as screws, nuts and seals, which must be replaced according to the ISTA repair instructions, must be selected from the Electronic Parts Catalogue according to the respective vehicle type and invoiced under the special defect code.

WARRANTY INFORMATION

Reimbursement for this Recall will be via normal claim entry utilizing the following information:

Defect Code:	0063560100	
---------------------	-------------------	--

Completion “before” vehicle delivery to the customer or the vehicle is already in the workshop

Labor Operation:	Labor Allowance:	Description:
00 66 725	3 FRU	Checking the rear lights on the tailgate (No repair is necessary) (Plus work)
Or:		
00 66 726	6 FRU	Checking the rear lights on the tailgate and replacing one rear light (Plus work)
Or:		
00 66 727	7 FRU	Checking the rear lights on the tailgate and replacing both rear lights (Plus work)

Or:

Completion after vehicle delivery to the customer (with no other Main work claimed)

Labor Operation:	Labor Allowance:	Description:
00 66 135	5 FRU	Checking the rear lights on the tailgate (No repair is necessary) (Main work)
Or:		
00 66 136	7 FRU	Checking the rear lights on the tailgate and replacing one rear light (Main work)
Or:		
00 66 137	9 FRU	Checking the rear lights on the tailgate and replacing both rear lights (Main work)

TREAD Act - Previous Customer-Pay Repairs

Based on the very small number affected vehicles and their current age (produced from December 21, 2017 through March 30, 2018), reimbursement requests for prior customer-pay repairs that specifically address the issue described in this Recall bulletin are not very likely.

Posted: Friday, July 20, 2018

ATTACHMENTSView PDF attachment [B630218 Recall Notice](#).View PDF attachment [2018-MY2018-G01-RearTurnSignals-QA-\(21June2018\)](#).