



## MODEL

I12 (i8)
----------

Produced through 08/28/2017

## SITUATION

A communication fault for Active Sound Design (ASD) shows up on a vehicle test

The following fault is shown:

- **S 0396** - No communication possible with: Vehicle Sound Generator (VSG)

## CAUSE

Due to a fault during vehicle identification, ISTA considers the VSG (option code SA 4U9) as part of the basic equipment of the I12.

## CORRECTION

Program the vehicle with ISTA 4.07.1 or higher.

Target I Level I001-17-07-502 or higher
---

## PROCEDURE

For conditions that are similar to the situation described:

1. Perform diagnosis with the latest version of ISTA.
2. Program the vehicle using ISTA 4.07.1 or higher

Note that ISTA 4 will automatically reprogram and code all programmable control modules that do not have the latest software.

**Always connect a BMW-approved battery charger/power supply (SI [B04 23 10](#)).**

For information on programming and coding with ISTA, refer to CenterNet / TIS / Technical Documentation / Diagnostics and Programming / Programming Documentation.

## PARTS INFORMATION

Parts replacement will not provide a solution to this situation.

## WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks or the BMW Certified Pre-Owned Program.

<b>Defect Code</b>	<b>6512881500</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
00 00 006	Refer to KSD2	Performing “vehicle test” (with vehicle diagnosis system – checking faults) (Main work)
00 00 556	Refer to KSD2	Performing “vehicle test” (with vehicle diagnosis system – checking faults) (Plus work)
And:		
61 21 528	Refer to KSD2	Connect an approved battery charger/power supply(indicated in KSD2 as “Charging battery”)
And:		
61 25 910	Refer to KSD2	Recharging high-voltage battery unit (to high voltage charging socket)
And:		
61 00 730	Refer to KSD2	Programming / encoding control unit(s)

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead of 00 00 006.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowances.

### Vehicle Programming and Coding

If a vehicle is affected simultaneously by another Technical Campaign or repair which also requires programming of the control units, the programming work may only be invoiced once.

ISTA automatically reprograms and codes all the vehicle control modules that do not have the latest software i-level. If one or more control module failures occur “during” this programming procedure:

- Please claim this “consequential” control module-related repair work under the defect code listed in this bulletin with the applicable KSD2/AIR labor operations.

### Other Repairs

Control module failures that occurred “prior” to performing this programming procedure:

- When “covered” under an applicable limited warranty, claim this control module-related repair work using the applicable defect code and labor operations in KSD2/AIR.