



This Service Information bulletin replaces SI B66 13 17 **dated October 2017**

## What's New:

- Model – Added new models.
- Correction: Removed note advising corrected as of 3/2017 in production.

## MODEL

G30 (5 Series Sedan)	 G12 (7 Series Sedan)	 G01 (X3)	 G32 (6 Series Gran Turismo)
----------------------	--	--	---

Produced between 11/1/16

With option 5DL - Surround View

Or

5DN – Parking Assistant Plus

## SITUATION

After programming the vehicle, the incorrect vehicle model is displayed in the CID (Central Information Display) when surround view camera function is active.

## CAUSE

ICAM2 (Integrated Camera) control unit software error.

## CORRECTION

Update the vehicle profile using ISTA.

## PROCEDURE

For conditions that are similar to the situation described:

1. Connect the vehicle to the current version of ISTA.
2. Perform the service function "Transmit vehicle profile".
3. The service function can be accessed as follows: Vehicle management / Service functions / Driver Assistance / All-round vision camera / Transmit vehicle profile.
4. Once the service function is completed, allow the vehicle to sleep for 5 mins before confirming the correct vehicle model is displayed when the surround view camera is activated.

**Always connect a BMW-approved battery charger/power supply (SI [B04 23 10](#)).**

## WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

<b>Defect Code:</b>	<b>6653040200</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
66 99 000	3 FRU	Work time to perform the service function "Transmit vehicle profile" (Main work)
Or:		
66 99 000	2 FRU	Work time to perform the service function "Transmit vehicle profile" (Plus work – Vehicle already in the workshop)
Or:		
66 99 000	1 FRU	Work time to perform the service function "Transmit vehicle profile" (Associated work – Vehicle already connected to the BMW diagnostic equipment)

Posted: Wednesday, February 14, 2018