



## CHECK CONTROL MESSAGE CROSSING TRAFFIC WARNING WHILEPARKING

This Service Information Bulletin (Revision 2) replaces SI B66 14 18 **dated August 2018**.

**What's New** (Specific text highlighted):

- Model
- Correction
- Procedure
- Warranty

### MODEL

E-Series	Model Description	Production Date	Affected Option Code
F90	M5 Sedan	July 2 <sup>nd</sup> , 2018  through  October 31 <sup>st</sup> , 2018	5AS – Driving Assistant or 5AT – Driving Assistant Plus Or 5AU – Driving Assistant Prof.
G05	X5 Sports Activity Vehicle		
G15	8 Series Coupe		
G30	5 Series Sedan		
G32	640i xDrive Gran Turismo		

### SITUATION

The check control message (CCM) "Crossing traffic warning. It is possible to continue driving" can appear when parking.

This can occur when the vehicle is parked too close to adjacent solid walls such as a single car garage or an underground parking space. The wall can be on either side of the vehicle, regardless if the vehicle is pulled in forwards or backed in.

If the customer switches the vehicle off and starts it again immediately, the same CCM may occur again.

Any of the following fault codes may be stored:

- 481CED Cancel function - Blindness - Left side
- 481CEF Cancel function - Blindness - Rear left
- 481CF0 Cancel function - Blindness - Rear right
- 481CF2 Cancel function - Blindness - Right side

### CAUSE

Software error with the side radar sensor SSR1.

### CORRECTION

Perform the test plan for the stored fault code.

### PROCEDURE

For conditions that are similar to the situation described:

1. Perform diagnosis with the latest version of ISTA.
2. Work through test module for the fault codes stored.
3. Follow test plan recommendations.

Note: The test plans are only displayed when the corresponding faults listed above are stored in the vehicle.

**Always connect a BMW-approved battery charger/power supply (SI [B04 23 10](#)).**

### PARTS INFORMATION

Parts replacement will not provide a solution to this situation.

## **WARRANTY INFORMATION**

This Service Information bulletin provides diagnostic information.

### **Eligible and Covered Work/Repairs**

When performed in conjunction with identifying and repairing a verified defect in materials or workmanship, ISTA diagnosis and working through the corresponding test modules based on the stored faults is covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

To submit a claim, please following the established and applicable warranty policy and procedures (Labor/Part/Sublet – bulk materials) that apply to the repair being performed.

Refer to AIR for the corresponding defect code, flat rate labor operations (including diagnosis) and the flat rate unit (FRU) allowances.

Only one Main labor operation code can be claimed per repair visit.

Work time (WT) labor operation codes require individual punch times and explanations on the repair order and in the claim comments section.