



Model

G01 (X3)	G02 (X3)		
Produced 8/1/2018-8/27/2018	With option code 493 Storage compartment package		

Situation

The support strap used to secure the luggage compartment cover in the raised position may be missing.

Cause


The incorrect luggage compartment cover may have been installed during production.

Correction

Inspect and replace the luggage compartment cover if necessary.

Procedure

1. Inspect the luggage compartment cover at location "2" shown below.

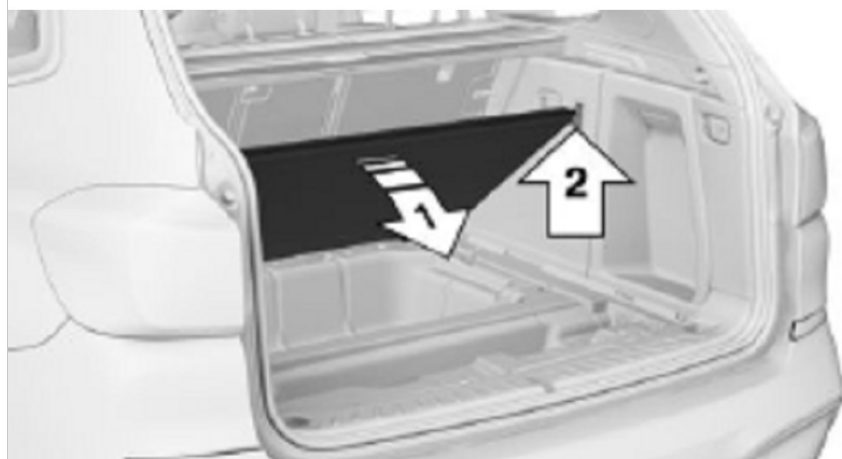

GRUSB5119-105

Is the support strap installed on the underside of the luggage compartment cover?

Yes: No further correction required, this bulletin does not apply.

NO: Proceed to step 2.

1. Install the correct luggage compartment cover outlined in the parts information section of this bulletin following repair instructions 51 47 102 "**Removing and installing/replacing the luggage compartment floor covering**".



Note: The part number outlined in the bulletin may be the same part number currently installed in the vehicle. Any part ordered after this bulletin is published will include the updated parts with the correct support strap.

Parts Information

Part Number	Description	Quantity
G01:		
51 47 9 462 948	Floor carpet, luggage compartment	1
G02:		
51 47 9 462 950	Floor carpet, luggage compartment	1

Warranty Information

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Defect Code:	5147186500	Hook/bracket, luggage compartment does not lock into position
Labor Operation:	Labor Allowance:	Description:
51 47 101	Refer to AIR	Removing and installing/replacing luggage compartment floor covering (Main Work)
Or:		
51 47 601	Refer to AIR	Removing and installing/replacing luggage compartment floor covering (Plus Work)