



This Service Information Bulletin (Revision 2) replaces SI B11 06 21 **dated April 2022**.

### What's New (Specific text highlighted):

- Information updated about engine oil filter cap drain plug

## MODEL

F90 (M5 Sedan)	F91 (M8 Convertible)	F92 (M8 Coupe)	F93 (Gran Coupe)
F95 (X5M Sports Activity Vehicle)	F96 (X6M Sports Activity Coupe)	G05 (X5 xDrive M5.0i Sports Activity Vehicle)	G06 (X6 xDrive M5.0i Sports Activity Coupe)
G07 (X7 xDrive M5.0i Sports Activity Vehicle)	G07 (ALPINA XB7)	G12 (750Li Sedan)	G12 (ALPINA B7)
G14 (M850i Coupe)	G15 (M850i Convertible)	G16 (M850i Gran Coupe)	G16 (ALPINA B8 Gran Coupe)
G30 (550i Sedan)			


## INFORMATION

When performing an engine oil service on vehicles equipped with a N63M, N63B or S63M engines; the ETK states to use "Set oil filter element" P/N 11 42 5 A33 C42 or P/N 11 42 5 A33 C43. The part numbers are not available at the moment.

Use the table below to determine the correct available part number.

Engine	New Part Number	Alternative Part Number
N63B and N63M	11 42 5 A33 C42	11 42 7 583 220
S63M	11 42 5 A33 C43	11 42 7 848 321

Note: Entering the part number written on the engine oil filter itself may supersede to the incorrect part number. Always enter the VIN into ETK when searching for applicable parts unless otherwise directed.

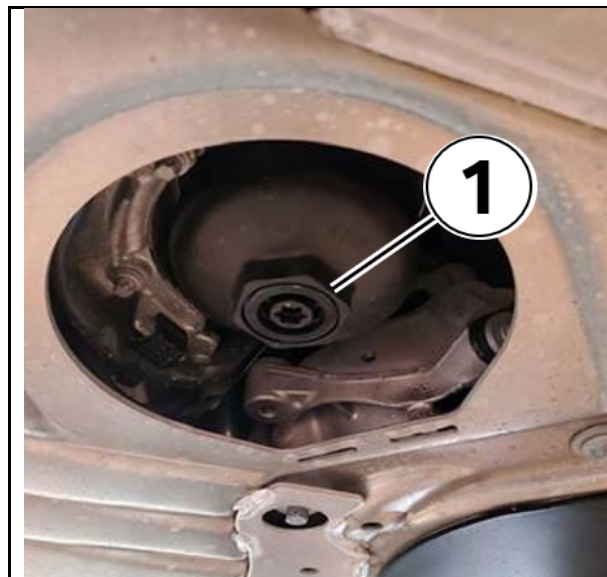

The vehicle may or may not have an engine oil filter cap with a plastic drain plug located in the center (1).

Do not remove the engine oil filter drain plug until further notice.

Set oil filter element P/N 11 42 7 583 220 and P/N 11 42 7 848 321 do not have the O-ring for this drain plug included in the contents.

Remove the entire engine oil filter cap to drain the engine oil and remove the engine oil filter.

## WARRANTY INFORMATION

Not applicable.